

Invigoration[™] 22 kW Steam Generator K-5543

Material

 Generators are constructed of insulated stainless steel, which maintains the temperature while ensuring the case is safe to the touch.

Technology

- Fast-Response[®] technology produces a luxurious steam shower in 60 seconds.
- Power Clean[™] technology offers one-touch automatic cleaning and safe maintenance.
- Constant Steam produces steam at a consistent rate, which greatly minimizes temperature fluctuations.

Installation

• 634 cubic feet maximum volume rating for custom showering applications.

Required Accessories

5549

- K- 5558 Tandem Steam Generator Control Kit
- K- 5562 large drain pan
- K- 5562 large drain pan

Installed component/s: Terminal block for electrical connections, and water inlet screen.

Loose component/s: 3/8 C x F Union, 1/2 C x F Union, and 3/8 C x M Union.



Codes/Standards


UL 499 CSA C22.2 No. 64

KOHLER[®] Steam Generator -Three-Year Limited Warranty

See website for detailed warranty information.



KOHLER. Faucets

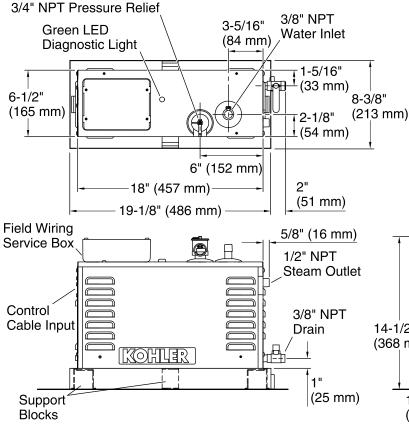

Required Electrical Service

One dedicated circuit required.

240 V, 120 A, 50/60 Hz

Technical Information

All product dimensions are nominal.


Invigoration[™] 22 kW Steam Generator K-5543

Minimum required access panel is 24" (610 mm) L x 15" (381 mm) H.

Allow for a minimum of 12" (305 mm) of space around all sides of the steam generator.

Allow for the drain/spill pan.

KOHLER[®] drain pan (shown with support blocks) sold separately.

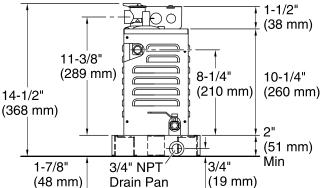

Notes

Install this product according to the installation guide.

Steam room volume for this generator is 634 cubic feet (18.0 cubic meters).

For every foot of ceiling height over 8 ft (2.4 m), use the next larger steam unit.

For optimum performance, the steam generator must be installed within 25 ft (7.62 m) of the steam head.

Recommended feed water quality should be: Hardness: 60 ppm (3.4 gpg). Total Alkalinity: 150 ppm (8.8 gp). To ensure proper operation, the feed water supply should be tested prior to operating the steam generator. If feed water quality is not within the specified limit, contact a reputable water treatment company for treatment options.

Maximum inlet pressure is not to exceed 70 psi (483 kPa).

